

TB 84 rev A

STANNAH LIFTS LTD

TECHNICAL BULLETIN

This bulletin supersedes TB84

INFORMATION ONLY

For the Attention of : Service Engineers, Trade Customers, Training Dept

Date : 19/10/2009

Product : MRLi Passenger Lifts

Subject : Pawl Device Retrofit Kit Modifications (further to bulletins TB82 & TB84)

Pages : 1

Originator : Stannah Lifts Ltd, Anton Mill, Andover, Hants SP10 2NX 01264 339090

Further to bulletin TB84 issued on 15th Sept 2009, please be advised that Modification 1 (for MRLi Lifts with 2 car entrances) did not function correctly and has therefore been withdrawn.


DO NOT PERFORM “MODIFICATION 1” WHICH WAS DETAILED IN TB84!!!

A revised method has now been determined and tested. Instructions and wiring diagrams will be provided with the necessary additional kit of parts.

Note: Modification 2 is still applicable and is included below for reference:

Modification 2 - MRLi Lifts with Delta wired control panels manufactured before 30/11/2006

On Delta wired lifts manufactured before 30th November 2006, the ‘VSR’ contact will not be present. Instead wire ‘PDR’ contact 21 to ‘UC’ contact 54, as detailed below.

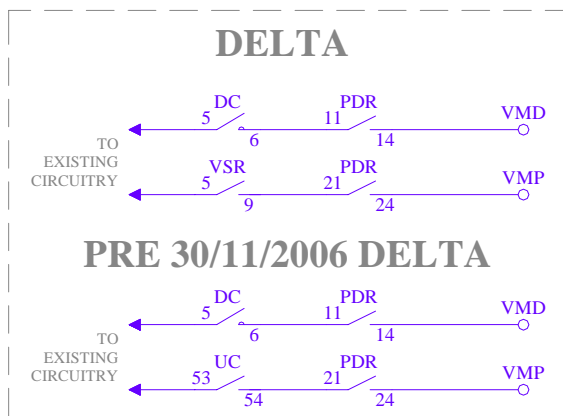

Kits dispatched after 14-09-2009 included revised drawings incorporating Modification 2.