



### Stannah Lifts Technical Bulletin

LIFT TYPE:- HOMELIFT



### **DESCRIPTION:**

It has become apparent that the performance of some Homelifts have been affected by a change in hydraulic oil specification incorporated between July 1997 and January 1998.

The oil specification was changed from Shell Tellus T37 to Shell Tellus 37. The viscosity of the Tellus 37 oil increases considerably at low temperatures and could result in the following symptoms if the hydraulic powerpack is located outside exposed to cold conditions:

- 1) Journey timer (TR1) tripping due to the inconsistent travel times.
- 2) Circuit breaker tripping.
- 3) Possible actuation of up ultimate limit switch.

### **CORRECTIVE ACTION:**

Homelift units which could be affected by the above scenario are listed on the following sheets.

#### HOMELIFTS INSTALLED BY STANNAH LIFTS LTD.

All of the units listed have exterior mounted powerpacks and it is recommended that the oil is changed to Shell Tellus T37.

This will be undertaken by installers based at Head Office in Andover and therefore no action is required by Service Branches. The list is for information only.

## HOMELIFTS SUPPLIED EX WORKS BY STANNAH LIFTS I.E. INSTALLED BY OTHERS.

All of the units listed incorporate the wrong specification of oil.

We are unable to ascertain the location of the powerpacks but recommend that customers arrange for the oil to be changed to Shell Tellus T37 if the powerpack is located outside exposed to cold conditions.

20/01/98/pe/word/phil/update







## Homelift Units Installed with Wrong Specification of Oil

# Units Installed by Stannah Lifts Ltd with Powerpacks Located Outside

Homelift	Service Branch	Total
Ref. No.		
HL 7091	Christchurch	1
HL 7040		
HL 7043	Birmingham	3
*HL 7063	_	
HL 7115		
HL 7117		
HL 7109		
HL 7084	Crayford	7
HL 7059	j	
HL 7042		
HL 7037		
HL 7116		
HL 7078	Eastbourne	3
HL 7064		
HL 7089		
HL 7085	Bristol	3
HL 7070		
HL 7087		
HL 7044	Manchester	4
HL 7049		
HL 7045		
HL 7086	Gateshead	1
HL 7068		
HL 7055	Norwich	3
HL 7054		
		25 Total Units

<sup>\*</sup> This unit is also due to have sound deadening fitted to hydraulic powerpack enclosure.



## Homelift Units Installed with Wrong Specification of Oil

# Units Supplied Ex Works Only by Stannah Lifts Ltd - Installed by Others

Homelift	Trade Customer	Total
Ref. No.		
HT 7048		
HL 7051	Olympic Lifts Ltd	4
HL 7052		
HL 7076		
HT 7053		
HL 7060		
HL 7066		
HT 7088	Peter Brown Ltd	7
HT 7111		
HT 7112		
HT 7113		
HT 7079	Bentley Mobility	1
	Services	
		12 Units Total