

TECHNICAL BULLETIN

For the Attention of : Service Engineers, System 21 Installers, Training Dept, Testers.

Date : 19th July 2007

Product : Nexus Controller

Subject : V4.16 Software changes

Status : Information only

Pages : 1 of 1

Originator : Stannah Lifts Ltd, Anton Mill, Andover, Hants SP10 2NX 01264 339090

Detail

V4.15 and V4.16 Nexus software has now been released to fix 2 very specific faults found within V4.13 and V4.14

Fixes

- ◆ Lift Locking up. Should a down call be placed on the lift system while the lift is anti-creeping, the lift would lock out of service. This is now resolved.
- ◆ When using an electronic valve block, the DOA output is used to control the motor pre-run and run-on. The control of this output was found to be intermittent for floor levelling. This issue has now been resolved.

Possible special requirement

- ◆ There may be circumstances where the new software is required but on an older lift. V4.15 has been made available for this purpose. It differs from V4.16 in only one way and that is that SDL2 is a normally off input, i.e. a feed has to be present to activate the SDL2 input.

Summary

The above items are the changes included in the V4.15 and V4.16 software. If you require specific clarification of any of these fixes, please contact the electrical design dept at Andover.