

## SAFETY BULLETIN

---

**For the Attention of :** Stannah Lift Services Ltd - Branch Managers, Phil Beresford, Jon Blight, Paul Ayres, Trade Customers

**Date :** 07/08/07

**Product :** System 21 Passenger Lifts  
Model: Piccolo from 1988 to 1993

**Subject :** Welded Floor Assemblies

**Status :** Safety Issue

**Pages :** 1 of 1

---

**Originator :** Stannah Lifts Ltd, Anton Mill, Andover, Hants SP10 2NX 01264 339090

---

### Detail

It has come to our attention that a S21 Piccolo Lift, Floor Assembly manufactured in 1991 has had some weld failures along the floor stiffener 'top hat' section where it attaches to the underside of the floor pan. 10 out of the 56 welds had failed. The purpose of this bulletin is to request that upon an individual Lift's routine inspection that the floor stiffeners are inspected for weld failures and the findings reported to Rob Sayer at Stannah Lifts Ltd 01264 343683.

At present we know this is an isolated occurrence and we want to confirm this with the site surveillance. If any welds are found to be broken the floor pan is to be fixed to the stiffener using a CSK rivet under the floor covering.

